

# Mach4 CNC Controller Screen Editing Guide Version 1.0

Copyright © 2014 Newfangled Solutions, Artsoft USA, All Rights Reserved

The following are registered trademarks of Microsoft Corporation: Microsoft, Windows. Any other trademarks used in this manual are the property of the respective trademark holder.

# **Table of Contents**

Chapter 1 Introduction	
1.1 About this Manual	4
1.2 A Note About Lua	4
1.3 Where is My Screen?	4
Chapter 2 The Editor	4
2.1 Open the Editor	4
2.2 Save the Current Screen	4
2.3 Load a New Screen	4
2.4 Close the Editor	5
Chapter 3 General Layout	5
3.1 Menu Bar	5
3.1.1 Screen Menu	5
3.2 Tool Bar	5
3.3 Controls	6
<ul><li>3.3 Controls</li><li>3.4 Screen Tree Manager</li></ul>	6
<ul><li>3.3 Controls</li><li>3.4 Screen Tree Manager</li><li>3.5 Properties</li></ul>	
<ul> <li>3.3 Controls</li> <li>3.4 Screen Tree Manager</li> <li>3.5 Properties</li> <li>Chapter 4 Create a Basic Screen</li> </ul>	
<ul> <li>3.3 Controls</li> <li>3.4 Screen Tree Manager</li> <li>3.5 Properties</li> <li>Chapter 4 Create a Basic Screen</li> <li>4.1 Create A New Blank Screen</li> </ul>	
<ul> <li>3.3 Controls</li> <li>3.4 Screen Tree Manager</li> <li>3.5 Properties</li> <li>Chapter 4 Create a Basic Screen</li> <li>4.1 Create A New Blank Screen</li> <li>4.2 Tab Controls</li> </ul>	
<ul> <li>3.3 Controls</li> <li>3.4 Screen Tree Manager</li> <li>3.5 Properties</li> <li>Chapter 4 Create a Basic Screen</li> <li>4.1 Create A New Blank Screen</li> <li>4.2 Tab Controls</li> <li>4.3 GCode Window</li> </ul>	
<ul> <li>3.3 Controls</li></ul>	
<ul> <li>3.3 Controls</li></ul>	
<ul> <li>3.3 Controls</li> <li>3.4 Screen Tree Manager</li> <li>3.5 Properties</li> <li>Chapter 4 Create a Basic Screen</li> <li>4.1 Create A New Blank Screen</li> <li>4.2 Tab Controls</li> <li>4.3 GCode Window</li> <li>4.4 Digital Readouts (DROs)</li> <li>4.5 Aligning Controls</li> <li>4.6 Buttons</li> </ul>	
<ul> <li>3.3 Controls</li> <li>3.4 Screen Tree Manager</li> <li>3.5 Properties</li> <li>Chapter 4 Create a Basic Screen</li> <li>4.1 Create A New Blank Screen</li> <li>4.2 Tab Controls</li> <li>4.3 GCode Window</li> <li>4.4 Digital Readouts (DROs)</li> <li>4.5 Aligning Controls</li> <li>4.6 Buttons</li> <li>4.7 LEDs</li> </ul>	

4.9 Static Text Controls	24
4.10 Sliders	25
4.11 Manual Jog Buttons	26
4.12 Manual Data Input (MDI)	27
4.13 Completed Screen	29

# **Chapter 1 Introduction**

### 1.1 About this Manual

This manual is intended to provide beginners with enough information to start building and editing their own screens and provide a quick reference for advanced users. After a concise description of all the controls available in the hobby and industrial versions of Mach4, there is a tutorial for beginner users. This tutorial will teach you how to use the most common controls and help you build a foundation on which you can construct more complex screens.

# 1.2 A Note About Lua

Although many, if not all, screen controls can be augmented with the use of Lua scripts, however, Lua programming is outside the scope of this manual. If you are unfamiliar with the Lua scripting language, please reference the Mach4 Scripting manual for further information. When applicable, this manual will indicate where Lua scripts can be used with various controls.

# 1.3 Where is My Screen?

The screen files (extension .set) are stored in the .../Mach4/Screens/ folder. This is the only place Mach4 will look for the defined screen. Place your screen file in this folder to access it from Mach4.

# **Chapter 2 The Editor**

# 2.1 Open the Editor

Open the screen editor by navigating to the "Operator" Menu and selecting "Edit Screen". The screen editor will be launched in the current Mach4 window.

# 2.2 Save the Current Screen

You can save your current edits by selecting the "Save Screen" option in the "Screen" Menu. Another option is to select the "Save Screen As" option to save your screen with a different name. The screen will also ask to save any changes when you close the editor.

# 2.3 Load a New Screen

A new screen cannot be loaded from the screen editor interface. Before entering the editor, you can load your preferred screen from Mach4's "View" menu (See the Mach4 Operation Guide for more information on Mach4's menu bar and controls).

# 2.4 Close the Editor

To exit the editor, follow the same procedure as opening it. Unselect the "Edit Screen" option, you can do this by clicking on it in the menu.

# **Chapter 3 General Layout**

### 3.1 Menu Bar

The menu bar spans the top of the Mach4 window. You will notice that in the editor it is slightly different than the standard Mach4 menu bar. Two items have been added that are specific to the editor, "Screen" and "Format". You can use these to menu items to do things like add controls or images, or align multiple screen items to each other.

#### 3.1.1 Screen Menu

- Save Screen: Click on this item to save the current screen. If no changes have been made, it will be grayed out.
- Save Screen As: Click on this to save the current screen with a different name.
- Manage Images: Use the manage images tool to add or remove images from the screen set. You can use these images as backgrounds, image buttons or static images.
- Add: You can use the add menu item to add controls to the screen, an alternative to using the tool bar.

# 3.2 Tool Bar

The tool bar is where you select the controls to add to the screen. There are a variety of controls from buttons to DRO's and panels. Figures 3.2-1 and 3.2-2 show you the controls available in the Hobby and Industrial versions of Mach4. As you can see Industrial includes a few extra controls. Clicking on a control icon adds it to the currently selected container in the screen.



Figure 3-2 Mach4 Industrial Screen Editor Tool Bar

# 3.3 Controls

Free hand V	Control Placement Type: Select how you want to place controls on the screen, "Free Hand" or "Snap to Grid".
Grid: 5	Grid Size: Set the grid size for "Snap to Grid" control placement type.
×	Delete: Removes the currently selected control from the screen.
	Add Page: Adds a page to tabs or the screen. Must have a tab control or screen selected to enable this tool.
	Group: Groups are containers for multiple controls, useful for keeping related controls together.
on	Button: You can use buttons to trigger events in Mach4 or program them with Lua scripts
	Image Button: Functionally the same as the standard button. Instead of only displaying text, you can use images to create custom buttons. You must first add the images to the screen with the image manager.
on off	Toggle Button: Toggle buttons trigger events the same as a standard button, but they stay on when clicked and turn off when clicked again. You can use these to turn on and off inputs or outputs, or run custom Lua scripts.
88	DRO: Digital Read Outs (DRO) are used to display numerical information from a variety of sources including axis positions and registers.
	LED: You can use LEDs to show the state of inputs, outputs and more.
G	G-Code: The currently loaded G-Code file will be shown in this control.
000 000	Toolpath: When you load a program the toolpath is generated and displayed in the toolpath control.
abc	Static Text: Used to display text, static or from another source, for example Mach status, registers, and other variables.
I	Text Box: You can use text boxes to get alphanumerical text input from users.
WINDLA	Static Image: Static images are pictures on the screen, you can display any image that has been added to the screen with the image manager.
	Tab Control: A tab control can contain one or more tabs, or pages, to display different sets of controls or information to the user. Add tabs to a tab control with the "Add Page" tool button.
	Slider: Sliders provide you with an easy way to adjust a value, for example feedrate or rapid override.
	Gauge: You can use gauges to display the status of variables that have an upper and lower limit, for example spindle override.
md i	MDI: A Manual Data Input (MDI) control allows you to manually enter GCode to be executed.

/	Line: You can use lines to visually separate sections of the screen.
	Tool Offset Table*
Ŷ <b>Ĭ</b>	Fixture Offset Table*
	Lua Panel: You can use Lua panels to create more advanced interfaces or self- contained sections of a screen. The contents of a Lua panel must be completely programmed in Lua and cannot be edited in the screen editor.
Ö.	Animation Control*: With this you can add an animated GIF (.gif) to the screen.
8	Plug-in Panel: Some plug-ins have settings windows or other displays that can be added to the screen with a plug-in panel. Contact the plug-in developer for more information on using their plug-in panels.
	G-Code Editor*: A version of GCEdit built right into the screen.

\*Controls only active in Mach4 Industrial

# 3.4 Screen Tree Manager

On the left side of the screen editor window you will find the "Screen Tree Manager". All of the screen elements are displayed in a tree according to their hierarchy in the screen. Each page in the screen will be listed by its name, by default there is one page titled "Default", with all the controls contained within it shown under it in the tree. If you don't see controls listed under the page name either there are no controls to show or you need to click on the box with the "+" to expand the tree ("-" to collapse it). Containers such as tabs or groups will also have a branch in the tree that shows the controls contained within.



Figure 3-3 Screen Tree Manager

A right click on any control in the screen tree manager displays a menu allowing you to delete, cut, copy or paste the object. For certain containers, there is also the option to import or export. For example, this allows you to easily transfer a tab with all its contents to a new screen.

### 3.5 Properties

On the left side of the editor, under the screen tree manager, you will find the properties window. This window displays all the editable properties of the currently selected control.

Pro	Properties ×					
	🔲 📑 🔒					
	Name	nbGCodeMDI1				
	Тор	218				
	Left	5				
	Height	234				
	Width	377				
	Enabled	✓				
	Hidden					
	Enable With M					
Ð	Enabled States					
	Default Tab	0				
	Current Tab	0				
	Text Height	14				
	Text Color					
	Text Active Co					
	Tab Height	26				
	Tab Color					
	Tab Active Col					
Ð	Styles					

Figure 3-4 Properties

There are two views of properties, selectable at the top of the properties window. The default view, shown in figure 3-4 is the property view. This view shows you basic properties such as name, dimensions, position, enable type, value, label, etc. The other view is the event view, selectable by clicking on the lightning bolt at the top of the window, figure 3-5.



Figure 3-5 Event Properties

The event properties window is where you can define the events, or actions, of buttons and other controls. Figure 3-5 shows the events for a standard button. For the button control, there are multiple events to choose from. The first two options, "Left Down Action" and "Left Up Action", give you a list of actions to choose from. These are predefined functions in Mach4, opening the drop-down menu will show you a list of all the actions to choose from. A left-down event is triggered when the left mouse button is pushed on the button, when the left mouse button is released the left-up action is triggered. In Figure 3-5 you can see the action "Feed Hold" is assigned to the "Left Up Action". So, when the button is released, feed hold will be activated.

If you desire a more complex action, the "Left Up Script", "Left Down Script" and "Clicked Script" options allow you to add a Lua script that will be executed on that event. For more information on Lua scripting please see the Lua Scripting Manual.

Many controls have events that can increase the functionality of your screen. Explore each control and see what can be done.

# **Chapter 4 Create a Basic Screen**

Sometimes it makes sense to start with an existing screen, like wx4.set, where all the controls are already placed. Sometimes a screen should be created from scratch, if it is going to be something completely different. For clarity, this manual will be showing you examples on a blank screen. There are a few screens included with Mach4, including a blank one. To start building your own screen copy one of these stock screens and start building.

NOTE! If you modify one of the stock screens and don't save it under a different name, it will be over written the next time you update Mach4 and any edits you've made will be lost. Always create your screens with a different file name.

Screens				- 0	×
F Home Share View S Cut Pin to Quick Copy Paste Paste Paste shortcut Clipboard	Move to * Copy to * Copy to *	New item • New folder New	Properties • Open • • Edit • History Open	Select all Select none Invert selection Select	^ <b>e</b>
$\leftarrow$ $\rightarrow$ $\checkmark$ $\uparrow$ $\blacksquare$ $\rightarrow$ This PC $\rightarrow$ OS (C:) $\rightarrow$ N	/ach4Hobby-V2-2872 → Screens			✓ Ö Search Scr	<i>م</i>
Ouick access	Name ^	Date m	odified Type	Size	
	Blank - Copy.set	11/29/2	013 4:45 PM SET File	1 KB	
This PC	MachLathe.set	5/22/20	15 2:23 AM SET File	310 KB	
💣 Network	wx4.set	10/14/2 10/14/2	015 8:42 PM SET File 015 8:42 PM SET File	1,277 KB 1,278 KB	
•4 Homegroup	wxlndustrial.set	2/18/20 10/15/2	16 11:27 AM SET File 015 10:28 SET File	1,277 KB 288 KB	
7 items 1 item selected 349 bytes					

### 4.1 Create A New Blank Screen

Figure 4-1 Mach4 Screen Folder

To Follow along with this manual, create a copy of the Blank.set screen set, see figure 4-1. Name it something memorable (for this manual I will be using EditorManual.set) and then start up Mach4 with the profile you want to use. When Mach4 finishes loading go to the "View" menu and select "Load Screen". Pick your new blank screen from the folder and open it. The new screen will load and you will be returned to the Mach4 window. The Mach4 screen will be completely blank, don't panic, this is a blank screen set so that is normal.

Now we can start adding controls! Open the screen editor (go to the "Operator" menu and select "Edit Screen"). With the editor open the first thing to do is set up the screen size. Select the screen name

from the screen tree manager and the screen properties will be displayed in the properties window, figure 4-2.

Ø Mach 4 - Industrial		-		×
File <u>E</u> dit <u>S</u> creen Format	View Wizard Operator Help			
Free hand V Grid: 5	D 🗙 📮 🔐 回 🔗 📟 🛄 🔾 🚰 🚺 🔤 📼 📼 🔚 🤚 🚽 🦯 🕌 🏫 💕 🤽	8	-	
Screen Tree Manager	x			
EditorManual				
Delaut				
Properties	×			
🔲 📑 🔒				
Name EditorManua	al			
Label Mach 4				
Design Width 1024				
Design Height 768				
PLC Interval 50				
PMC Objects				

Figure 4-2 Screen Properties

In the "Properties" window you will see two options to set the size, "Design Width" and "Design Height". The blank screen set is set up for a 1024x768 screen. These values are in pixels and should be set to match the resolution of your desired screen. If this height and width does not match the screen then the Mach4 window will be stretched to fit, contents included, so your screen may not display exactly as intended.

Now you can start adding controls to the screen. You'll notice when the screen is selected as in figure 4-2 most of the controls in the tool bar will be unavailable, this is because controls need to be added to containers. There are three container types available, pages, groups and tabs. In the blank screen, there is already a page added for you, named "Default". You can select by clicking on default in the screen tree manager or by clicking on blank space in the main window. When the default page is selected all the controls in the tool bar will activate.

# 4.2 Tab Controls

You want to have a couple different views in this screen so start by adding a tab control. The new tab control will be added to the top left corner of the page and you'll see the control added to the screen tree manager with a single tab. In figure 4-3 you can see the tab control named "nob" and the single tab named "nbp". These names do have some meaning, "nob" is short for notebook and "nbp" short for notebook page. These are the programming names for this type of control.



#### Figure 4-3 Add a Tab Control

Now let's make the tab control fill the top half of the screen, select "nob" on the screen tree manager and set the height to 500 and the width to 1004. Notice the tool bar, there are only two options available, "Delete" and "Add Page". Click the add page button to add another tab to the control. Click on the tabs ("nbp" and "nbp(1)") in the screen tree manager and change the label properties to "GCode" and "Tool Path", see figure 4-4.

Ø Mach 4 - Industrial	- D X				
File Edit Screen Format View Wizard Operator Help					
Free hand 🗸 Grid: 5 🗘	🗙 📭 🕄 💷 💌 🔛 🕥 🎑 🔛 📼 📼 👘 🖕 🔒 🛗 🦯 🕌 🛸 🗉 🗛 🔕 🚾 -				
Screen Tree Manager × EditorManual ⊡ nob □ nbp □ nbp(1)	GCode Tool Path				
Properties X Name nbp(1) Enabled V					
Hidden Label Tool Path					
Bg Image					

#### Figure 4-4 Renamed Tabs

The label is the displayed name of the control, this is true for tabs, buttons, static text, etc. The name field is the name that will be displayed in the screen tree manager and the name that can be used to access the control from a Lua script.

### 4.3 GCode Window

Now let's add a GCode window to the new "GCode" tab, and a tool path display to the "Tool Path" tab. Click on the GCode tab, or select "nbp" from the screen tree manager, then click on the "Add GCode Display" button in the toolbar. A window will appear at the top left corner of the tab. If the new control appears at the top corner of the page, or behind the tab, then you had the page selected and not the desired tab. Now resize the GCode display to fit the tab. Hover your mouse over the button right corner and the pointer should change to a double headed and angled arrow. Click and drag the corner to set the desired size. Repeat these steps with a tool path display on the tool path tab.



#### Figure 4-5 Tool Path Display

### 4.4 Digital Readouts (DROs)

Next let's add some buttons and DROs to the bottom of the screen. Select the page (either in the main window or from the screen tree manager) and add a DRO. it will be added at the top left corner of the page, behind the tab control. The easiest way to move it is to select it in the screen tree manager and type in the desired position or some position (0,0 for example) where you can see the control to click and drag it to position. For this example, we know we want the values we want, Top = 518, Left = 514, Height = 65, Width = 500. At the same time change the border to "Static". Now to add two more. Right click on the DRO and select Copy, the right click again and select Paste. Then right click and select Paste again, there are now 3 DROs all in the same place. You can move them around by clicking and dragging them, by selecting them and then holding control and using the arrow keys on the keyboard, or typing in positions. Just roughly drag the two new ones so they are stacked as in figure 4-6. They do not need to be perfectly aligned, you will fix that in the next step.



Figure 4-6 DROs Added

# 4.5 Aligning Controls

Now, you can align them. Move the lowest DRO close to the bottom of the screen and then hold control and select the other two DROs, middle and then top. The order of selection is important! Now go to the "Format" menu and move the mouse over "Spacing..." and then select vertical. The three DROs will be evenly spaced keeping the top and bottom DROs in their current position. Next go back to the "Format" menu and move your mouse over the "Align..." option and select "Rights". This will align the right edges of all the selected control to the LAST selected control, this is the reason the selection order is important. You should be left with a screen that looks like figure 4-7. Next you will add some functionality to the DROs.



#### Figure 4-7 Aligned DROs

Click on the first DRO, we will make this the X axis position DRO. In the property window find the item named DRO Code and open the drop-down menu, select "X Multiple Pos". The middle one should be set to "Y Multiple Pos" and the bottom one "Z Multiple Pos". The multiple position option allows you to display absolute, machine and distance-to-go data in the same DRO. Later you will add buttons to toggle between these functions. Right now, let's add some labels so we don't forget which is which. Follow the same basic procedure as for adding the DROs but add static text controls instead. Use the format tools to align the labels with the DROs. You should end up with a screen that looks like figure 4-8.



Figure 4-8 Static Text Labels

# 4.6 Buttons

To make this screen useful you need to add a few buttons to load a program, enable, start and stop a program, etc. Let's start with the enable button. We'll make this a large toggle button on the bottom left side of the screen. Select the default page and click "Add Toggle Button" on the tool bar. Once again it will show up on the screen at the top left corner under our tab control. Move the control to Top = 701, Left = 18 and resize it to Height = 50, Width = 400. You also want to change the test displayed on the button and the color. For toggle buttons, there are two states, up and down. For the enable button you want the "Text Up" to be "Enable" and "Text Dn" to be "Disable". Change the "Button Color Up" property to green and the "Button Color Dn" to red. To change the color, click on the property in the property window and then select the color from the palette. Figure 4-9 shows the properties settings for the new button.

Pro	perties			×
1	i 🧊 🔒			
	Name	tog		
	Тор	701		
	Left	18		
	Height	50		
	Width	400		
	Enabled	✓		
	Hidden			
	Enable With M			
+	Enabled States			
	Text Up	Enat	ole	
	Text Dn	Disa	ble	
	Text Height	9		
	Text Color Up			
	Text Color Dn			
	Button Color L		Green	
	Button Color E		Red	
	Blink Rate Up	0		
	Blink Rate Dn	0		
	Image Up			
	Image Dn			
	Scale Method	Nor	mal	
	Button State	Up		
	Input Signal			
	Output Signal			
	Font			

#### Figure 4-9 Enable Toggle Button Properties

Now you need to add the actions to the button that will enable and disable Mach4. In the properties window click on the lightning bolt and for the "Down Action" select "Enable On" from the drop-down list. Then set the "Up Action" to "Enable Off", see figure 4-9. You should have a button on the screen that looks like figure 4-10.



#### Figure 4-10 Enable Toggle Button

Next you will be adding some standard buttons to the screen and some LEDs to show the home status of the axes. Add 9 standard buttons and set the Height = 40, Width = 90 and label and position them as shown in figure 4-11. Add three LEDs and position them as shown.

Cycle Start     Load GCode     Edit     Home All       Feed Hold     Machine Pos	0.000000
Stop Dist-To-Go o Y	0.000000
Enable	0.000000

#### Figure 4-11 Control Buttons and LEDs

At this point you should be comfortable adding the controls, positioning them and changing the displayed text. Now we need to add the actions. All the buttons will have predefined actions for their function, except for the "Home All" button, which we'll get to later. For example, click on the "Cycle Start" button and then go to the events properties. The first option is "Left Down Action". Select "Cycle Start" from the drop-down menu to define the function. Repeat for "Feed Hold", "Stop", "Reset", "Load GCode", and "Edit", selecting the appropriate function from the drop-down menu.

For the "Machine Pos" and "Dist-To-Go" buttons, select "Machine Coordinates Toggle" (or "Distance To Go Toggle" for both the left down and left up actions, figure 4-12. Now when you push the button down the DROs will display the machine or distance-to-go coordinates, when you release the button they will go back to the absolute coordinates.

Pro	Properties X				
	i 🧊 🖬				
	Left Down Act	Machine Coordinates Toggle			
	Left Up Action	Machine Coordinates Toggle			
	Left Down Scri				
	Left Up Script				
	Clicked Script				
	Lost Focus Scr				
	Goto Page				
	Run MDI				

Figure 4-12 Machine coordinate button actions

Now for that special "Home All" button. There is no option for home all from the drop-down list. You must add a Lua script to that button. Select the "Left Down Script" action to open the script editor and copy the following text:

```
local inst = mc.mcGetInstance()
local rc = mc.mcAxisHomeAll(inst)
if (rc ~= mc.MERROR_NOERROR) then
    mc.mcCntlSetLastError(inst, "Error starting home all")
end
```

Close the Lua editor and save the changes.

# 4.7 LEDs

The LEDs also need to be assigned to signals to turn them on and off. In this screen, you want them to display the homed state of each axis. Select the X axis led to display its properties in the properties window, shown in figure 4-13.

Pro	Properties ×				
	i 🧊 🔒				
	Name	led			
	Тор	542			
	Left	426			
	Height	16			
	Width	16			
	Enabled	✓			
	Hidden				
	Enable With M				
Ŧ	Enabled States				
	Shape	Round			
	Square Border	None			
	Value	On			
	Color	Red			
	Scale Method	Normal			
	Туре	Normal			
	Blink Rate	500			
	Input Signal				
	Output Signal	X Homed			

Figure 4-13 LED Properties

Input and output signals can be assigned to an LED, see the bottom two properties in the window. Assign the LED to the "X Homed" signal. Don't get "X Homed" confused with "X Home". "X Home" is a different signal and will only display the status of the home switch, not the homed state of the axis. Set the Y and Z LEDs to display those home states as well

### 4.8 Editing Completed Screen

You have now completed a very basic screen. It should look like figure 4-14. Exit the editor by going to Operator>Edit Screen and save the screen. Try changing tabs, loading a program, etc.

Machineset     Hereiter	8 Marsi-Indunal – C X
Pile Tee Schlare Deputit Haid Operatin Hep Goden Test Not.	Pier Vew Configure Dispersite Waterd Operator Helds [Licities: Insurfaces
F60.000000         F           G0 X0.000000 Y0.000000 Z0.200000         M3 (start Spindle)           S60.000000         G43H5           G0 X0.000000 Y0.0000000 Z5.00000         G0 X1.179950 Y4.004260 Z0.200000           G1 X1.179950 Y4.004260 Z-0.100000         G1 X1.179950 Y4.004260 Z-0.100000           G1 X1.179950 Y4.004260 Z-0.100000         G1 X1.179950 Y4.004260 Z-0.100000	
Constitution         Call         Here #         • X         0.0000000           Fact Nation         Marcine Nation         Marcine Nation         • Y         0.0000000	Specification         Loss / Column / Colum
•Z 0.000000	•Z 0.000000

Figure 4-14 Finished Example Screen

Immediately you'll notice this screen works for running a program, but it is missing a couple key features. There are a few things we will want to add, sliders for feed rate and rapid override, a status bar to display messages and some jog controls. Start with the status bar. A good place to put it is across the top. Start by resizing the tab control, select it and drag the top edge down to get enough room to put a static text control across the top, with another for a label and a history button, figure 4-15.

### 4.9 Static Text Controls



Figure 4-15 Add status bar at the top

Figure 4-15 shows the addition of the status bar at the top. There is one static text control to display the "Status:" label, a second one to display the last or current message and finally a button to show the message history. To set a static text control to display the data like the current message you need to select a label code in the control's properties, figure -16. Select the static text control that will become your status bar and select "Last Gcode Message" from the drop-down menu in the "Label Code" property. Lastly, you need a history button to see previous messages. Add a button, name it "History" and set the left down action to "Show Message History".

Pro	Properties ×		
	1 📑 🔒		
	Name	IblStatus	
	Instance	0	
	Тор	3	
	Left	71	
	Height	30	
	Width	841	
	Enabled	✓	
Œ	Hidden		
	Enable With M		
	Enabled States		
	Justify	Left	
	Border	Static	
	Label		
	Lines	1	
	Font	Swiss	
	Style	Normal	
	Weight	Normal	
	Underline	Off	
	Fg Color	Black	
	Bg Color		
	Label Code	Last Gcode Message	
	Register		

Figure 4-16 Static text properties

### 4.10 Sliders

Now let's introduce some new controls, sliders. Sliders are useful for dynamically varying the value of something, like feedrate override. Add a couple sliders in the empty space between the buttons. In the properties set the "Code" to "Rapid Rate Override" and "Feed Rate Override". Generally, the upper and lower limits of the rapid override should be 0-100, and the feedrate override 0-200. These settings allow you to stop the motion and increase the feed rate if needed. See the properties in figure 4-17.

Properties	×		
🔲 🔯 🔒			
Name	sli(10)		
Instance	0		
Тор	651		
Left	125	Cycle Start	Load GCode Edit Home All
Height	45		
Width	191		Feedrate Override
Enabled	<ul><li>✓</li></ul>	Feed Hold	0 Machine Pos
Hidden			0
Enable With N	M 🗌	Stop	Dist-To-Go
🗄 Enabled State	s		Rapid Override
Code	Rapid Rate Override		0 100
Min Value	0	Reset	100
Max Value	100		
Value	0		
Fg Color	Black		Enable
Options	Horizontal, Labels		

Figure 4-17 Add override sliders

Exit the editor and play with the sliders. Click and drag the pointer to adjust the value anywhere in between the Min and Max value you set in the properties.

### 4.11 Manual Jog Buttons

Lastly, add some controls for manually jogging the machine. A good place to put these is on another tab. Enter the editor and add a page to the tab control. Next add some standard buttons, two for each axis, and arranged in a way that makes sense to you, see figure 4-18 for an example layout.

GCode Tool Path Jogging			
	Y +		Z.+
X-		X +	
	Υ.		Z -

Figure 4-18 Jog button tab

Once the buttons are added you need to assign actions to make the machine jog. Jogging is a bit tricky, there are two actions that need to be used to get a button to do what you expect. The first action, which you will assign to the down action, starts the jog command. The second action, which you will assign to the up action will end the jog command. For an example see figure 4-19 for the event properties of the Y+ button.

Pro	perties	×
	i 🧊 🔒	
Γ	Left Down Act	Jog Y+
	Left Up Action	Jog Y Off
	Left Down Scri	
	Left Up Script	
	Clicked Script	
	Lost Focus Scr	
	Goto Page	
	Run MDI	

Figure 4-19 Y + job button actions

If you forget to add the "Jog Off" action, then the axis jog will start and not stop. This is a very important thing to remember. With these actions defined, when the button is pushed the machine will jog until it is released.

# 4.12 Manual Data Input (MDI)

The last thing that will be added as a part of this manual is an MDI (manual data input) window. Let's put this on yet another tab, named MDI. An MDI window allows you to manually enter blocks of GCode to be executed. Adding the MDI window is straight forward, executing it is where it gets a bit tricky. So, add a tab and insert an MDI window, size it to fit the tab, figure 4-20.

GCode	Tool Path Jogging MDI	
		_
Ω		
_		
L Û		
		-

#### Figure 4-20 MDI tab added

There are a couple options for executing the contents of the MDI window. One is to add a new button to only execute the contents of the MDI window. There is an event property on standard buttons named "Run MDI", select the name of the MDI window you want this button to execute and that is it. The other way, which will be covered in this manual is to have the "Cycle Start" button run either the currently loaded GCode file or the MDI window depending on what the user is looking at. This way the screen is simplified and avoids unintended automatic operation. Start by clicking on the "Cycle Start" button and navigate to the event properties. Remove the "Cycle Start" event from the "Left Down Action". Next you can add a "Left Down Script". The following Lua code can be copied and pasted into the Lua editor:



Close the Lua editor and save the code. Exit the screen editor and test your new controls. Pay attention to the status bar, the "mc.mcCntlSetLastError()" statements write to the status bar. It's a good way to know what your custom events are doing. Try some MDI code, try to cycle start the program when the Jogging tab is active.

### 4.13 Completed Screen

That concludes the creation of a basic example screen. This screen is only meant as an example of how to edit and create screens. There is still plenty to add to this screen, on the Jog screen alone you could add sliders for jog speed, buttons to toggle between continuous and incremental jog and DROs and buttons for the increment amount. There are many functions available in Mach4, far more than fit into the scope of this manual. However, armed with the basics learned in this example you can explore the rest of the controls and their actions to build the rest of your screen. And remember, if a predefined action is not available, nearly anything can be done using the Lua interface, more information on that can be found in the Lua Scripting Manual.



Figure 4-21 Completed example screen